


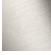




CL.1 Single-lever bidet mixer without pop-up waste - Brushed Champagne (22kt Gold)

CL.1


33 600 705	Product version from 5/10/2021		
	<ul style="list-style-type: none"> • 145mm projection • pivotable spout 30° • rectangular, air-enriched flow • height of mixer 190 mm • height up to aerator 113 mm • hole diameter 35 mm • 2x screw-in M 8 x 1 pressure hose, leak-tested • max. flow 6 l/min • WRAS 	<div>  Brushed Champagne (22kt Gold) </div>	33 600 705-46
		<div>  Chrome </div>	33 600 705-00
		<div>  Brushed Platinum </div>	33 600 705-06
		<div>  Dark Chrome </div>	33 600 705-19
		<div>  Champagne (22kt Gold) </div>	33 600 705-47
		<div>  Brushed Dark Platinum </div>	33 600 705-99



CL.1 Single-lever bidet mixer without pop-up waste - Brushed Champagne (22kt Gold)

CL.1

33 600 705 Product version from 5/10/2021
mm [inches]

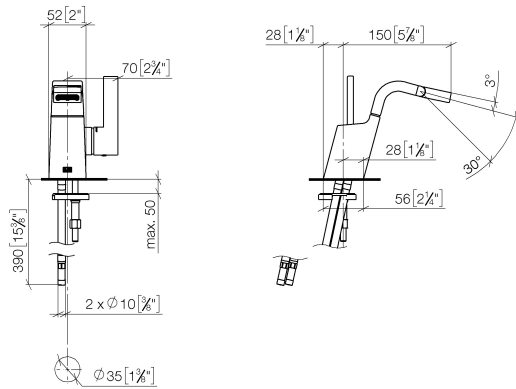

Flow rate chart



Codes & Standards

DIN 4109

ISO 3822

Scottish Water
Byelaws

UK Water Supply
Regulations

Ü-Zeichen



CL.1 Single-lever bidet mixer without pop-up waste - Brushed Champagne (22kt Gold)

CL.1

33 600 705 Product version from 5/10/2021

Certificates and sustainability

LGA_38


WRAS_240202

CL.1 Single-lever bidet mixer without pop-up waste - Brushed Champagne (22kt Gold)

CL.1

33 600 705 Product version from 5/10/2021

Parts for other
finishes can be found
here: [Chrome](#)

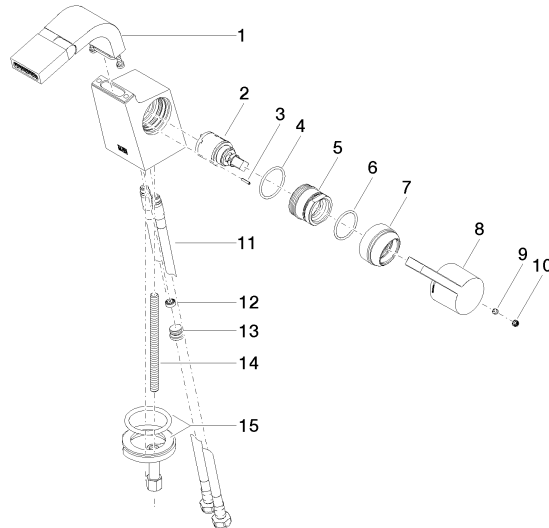

Spare parts list

No.	Item Number	Name	Quantity used	Delivery time
10	90 31 20 109 00 90	plug	1.00	2
4	09 14 10 137 90	seal	1.00	2
13	04 31 20 039 11 90	plug	1.00	2
8	09 20 67 010-46	handle	1.00	60
9	90 31 11 030 00 90	pin	1.00	2
7	09 28 30 029-46	cover	1.00	60
5	09 24 04 294 90	sleeve	1.00	2
2	90 15 05 042 00 90	cartridge	1.00	2
15	04 30 11 038 75 90	fixing set	1.00	2
6	90 14 10 063 00 90	seal	1.00	2
12	09 23 01 034 90	flow reducer	1.00	2
11	04 30 04 100 00 90	hose	2.00	2
3	09 31 11 152 90	pin	1.00	2
14	09 31 11 012 90	pin	1.00	2
1	90 11 70 004 00-46	spout	1.00	-

Spare part can no longer be ordered, please order the replacement item