

MADISON Bath shower set for bath rim or tile edge installation - Platinum

MADISON








27 502 360

Product version from 7/31/2009



- spout: circular, air-enriched flow
- max. spout flow rate 23 l/min
- Hand shower: COMPACT RAIN, max. flow rate 6.8 l/min (at 3 bar)
- complete hand shower set with anti-scale system
- 225mm projection
- automatic bath/shower diverter
- height of mixer 185 mm
- height up to aerator 140 mm
- hole diameter valve 32 mm
- hole diameter spout 32 mm
- hole diameter for complete hand shower set 32 mm
- rosette for complete hand shower set Ø 55mm
- rosette for deck valve Ø 55mm
- metal shower hose 1750mm with integrated anti-twist protection

Intrinsic protection against back flow.

	Platinum	27 502 360-08
	Chrome	27 502 360-00
	Brushed Platinum	27 502 360-06
	Durabrand (23kt Gold)	27 502 360-09
	Brushed Durabrand (23kt Gold)	27 502 360-28
	Brushed Dark Brass	27 502 360-39
	Brushed Dark Platinum	27 502 360-99

Recommended miscellaneous


	Perfecto installation kit -	12 614 970 90
---	-----------------------------	---------------

Recommended miscellaneous

	Decorative caps for Perfecto - Platinum	12 801 970-08
	• 1 pair	

27 502 360 Product version from 7/31/2009

mm [inches]

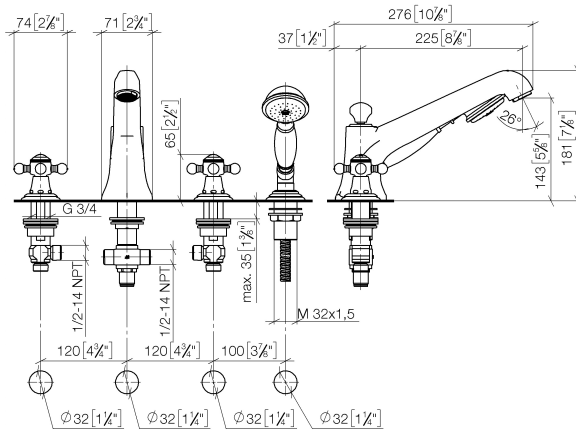

### Flow rate chart



### Codes & Standards

DIN 4109

EN 1717

ISO 3822

Ü-Zeichen



## MADISON Bath shower set for bath rim or tile edge installation - Platinum


MADISON

27 502 360 Product version from 7/31/2009

### Certificates and sustainability

LGA\_8

Belgaqua\_21-380-2

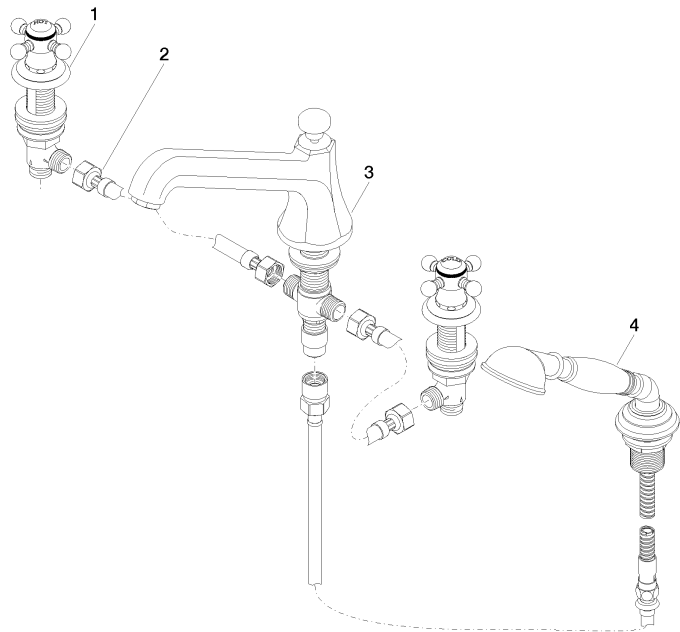

**Spare parts list**

No.	Item Number	Name	Quantity used	Delivery time
3	13 502 380-08	spout	1.00	60
1	20 000 360-08	MADISON Deck valve clockwise closing cold or hot - Platinum	2.00	-
Spare part can no longer be ordered, please order the replacement item				
2	12 502 970 90	High pressure hose 1/2" x 1/2" x 400 mm -	2.00	2
4	27 703 360-08	MADISON Hand shower set for bath rim or tile edge installation - Platinum	1.00	-
Spare part can no longer be ordered, please order the replacement item				